

PRODUCT SAFETY

Snap-on Incorporated

ADVISORY

May 22, 2014

PRODUCTS AFFECTED:

PART NUMBERS & DESCRIPTION:

ST4029446 (EAA0332G81A), EAA0351G93A, and EAA0332G83A


Tire Changer Clamping Adaptors

HAZARD:

There is a potential of missing fastener(s) that can contribute to jaw failure that may cause property damage or personal injury.

ACTIONS:

1. Inspect each of the adaptors at the customer's location.
2. Determine if both bolts are present per the below images:
 - If one or both bolts are **not** present obtain the entire set from the customer and return the entire adaptor set to Snap-on Equipment with a copy of this advisory. Call 800-225-5786 to obtain the replacement set for the customer.
 - If bolts are present check that the torque is a minimum of 16 lb-ft.
3. Inspect the adaptors for cracking, misalignment or any other visible damage.

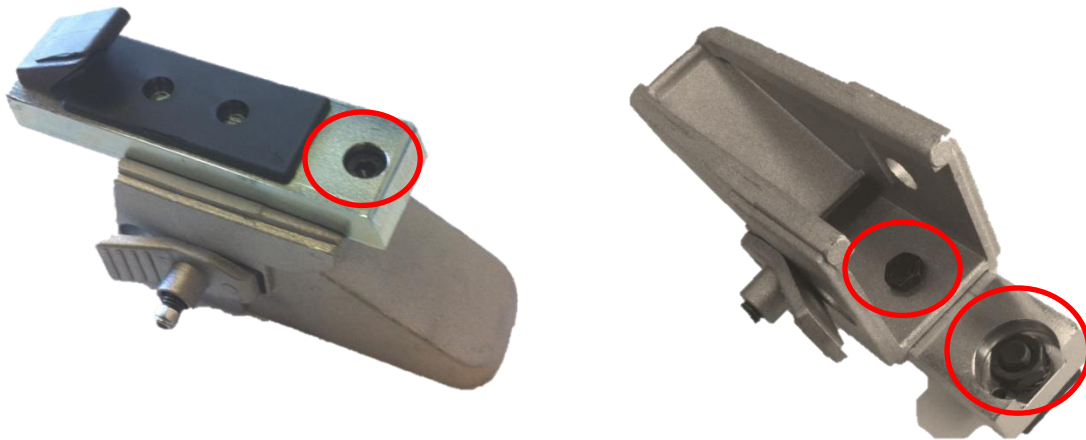

Images of listed Tire Changer Clamping Adaptors. Check circled fasteners for proper torque (16 lb-ft).

QUESTIONS:

If you have questions on this advisory or need assistance contact: [Mike DeKeuster - 262-656-6677](mailto:Mike.DeKeuster@Snap-on.com)