


## EELR334A Turf Equipment Lift is a 6,000 lb. capacity, twin post lift for golf and lawn equipment

The new **EELR334A Turf Equipment Lift** requires only a 12' ceiling height, as compared to 13' 6" for the previous **EELR303A**. This lower ceiling height means the unit can operate in more shops. The lift features front adjustable wheel tray, two rear wheel forks, arm extensions, three position metal flip-up pads, premium cassette-style arm restraints. Wheelbase range is 46" to 79". Wheel track range is 36" to 106".

- Heavy duty 6,000 lb. (2,721 kgs.) capacity for turf vehicles; 9,000 lbs. (4,082 kgs.) for cars/trucks
- Full stand-up lifting height enables easy access underneath vehicle
- Lower ceiling height to fit more shops
- 10-angle, roll-formed columns for strength
- Cable equalization with steel pulleys & bronze bushings
- Automatic arm restraints and full contact greasable arm pin sleeves for long life
- 16-position Safety Lock with single point lock release and two-hand lift lowering to save time and promote safety
- Moveable wheelforks and wheel tray for convenience

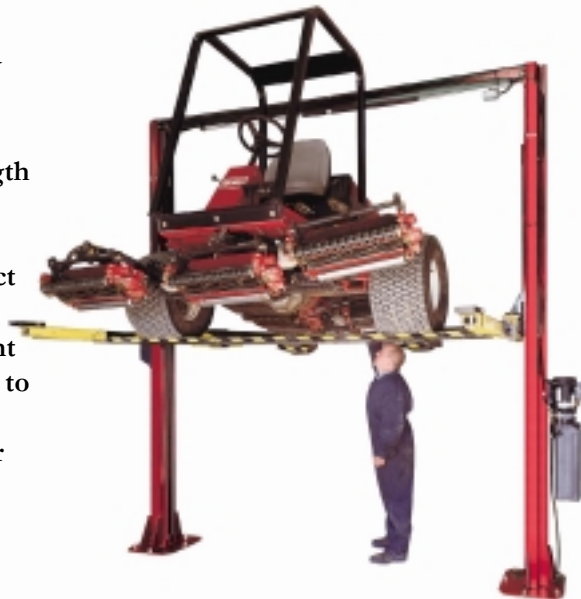

**Optional Items:**

**EELR304A Wide Front Wheel Tray**

**EELR316A Gang Mower Adaptor**

**EELR334A Specifications:**

Capacity	6,000 lbs. ....	2,721 kgs
Overall width	144" .....	2,700 mm
Width between columns	120" .....	3,658 mm
Drive-Thru width	109" .....	3,048 mm
Overall height	144" .....	3658 mm
Under bar clearance	140" .....	3556 mm
Height to lowered lift pads	5" .....	127 mm
Height to raised low lift pad	5-3/4" .....	146 mm
Front arm length	35" to 53" .....	895 to 1,359 mm
Rear arm length	35" to 53" .....	895 to 1,359 mm
Maximum lifting height	78" .....	1,880 mm
Power requirements (Std.)	.....	230V AC 1 Ph-60 Hz
(Other electrical options available)		



**WARNING**

- Improperly installed lift can collapse.
- Wear safety goggles while using lifts (user and bystanders.)
- Do not exceed load limit of lift.
- Do not raise or lower lift unless area is clear of people.
- Lifts must be installed by experienced installer.
- Collapsed lift can cause injury.